
SERVICE LETTER

Equipment Type(s): DA-1503B p/n 071-01593-0100 Antenna Drive

Subject: Field Modification of Units due to Manufacturing Error

Affected Units: The following serial numbered units are believed to have incorrect hardware installed at the factory.

Unit S/N
T2000 thru T2025
T2027
T2028
T2037
T2038
T2043

As these units may experience future malfunctions, customers with the above units will be furnished a repair kit so that the correct hardware can be installed.

Repair Kit: The kit consists of four (4) screws p/n 089-06494-0024.

**Inspection
Procedure:**

Remove this screw at the rear of the DA-1503B.

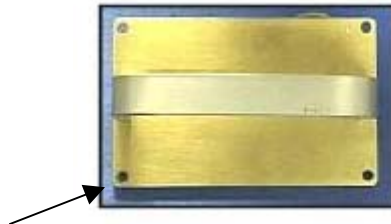


Figure 1. DA-1503B Rear View

If the screw length is 1.25 inch, all four screws must be replaced with p/n 089-06494-0024 which is 1.50 inches long. See Figure 2 for disassembly and re-assembly guidance.

If the screw length is 1.50 inch, re-attach the original screw as no modification is required.

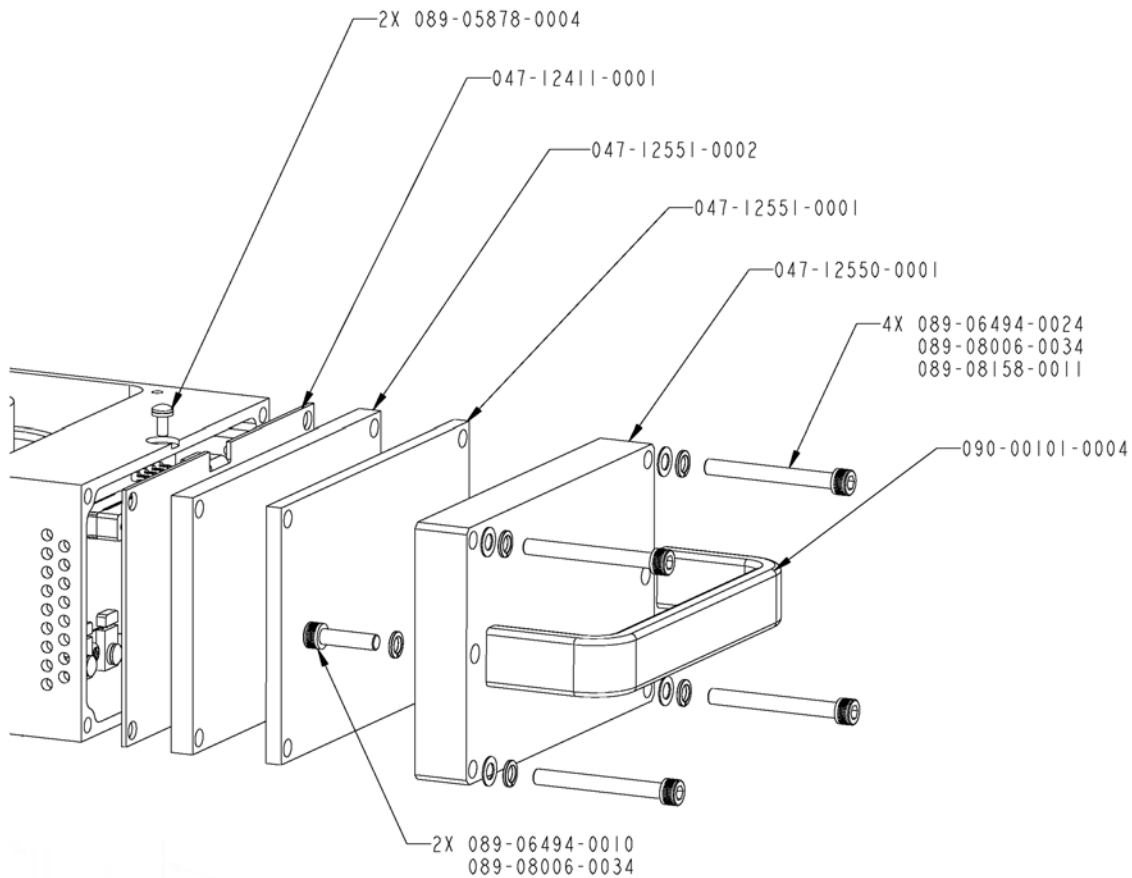


Figure 2. DA-1503B Antenna Drive Counterweight Assembly

For additional information contact:

Telephonics Corporation
Command Systems Division
Product Support Group
815 Broad Hollow Road
Attention: Mr. Kenneth Bernstein – Mail Stop 14
Farmingdale, NY 11735
Phone: 631-755-7081
Fax: 1-631-755-7227
e-mail: bernstein@telephonics.com

and refer to this service letter.